

LOGSTOR HDHEC Installation Instructions - Industry




HDHEC

High temperature end cap

Fitting Instructions

1/3

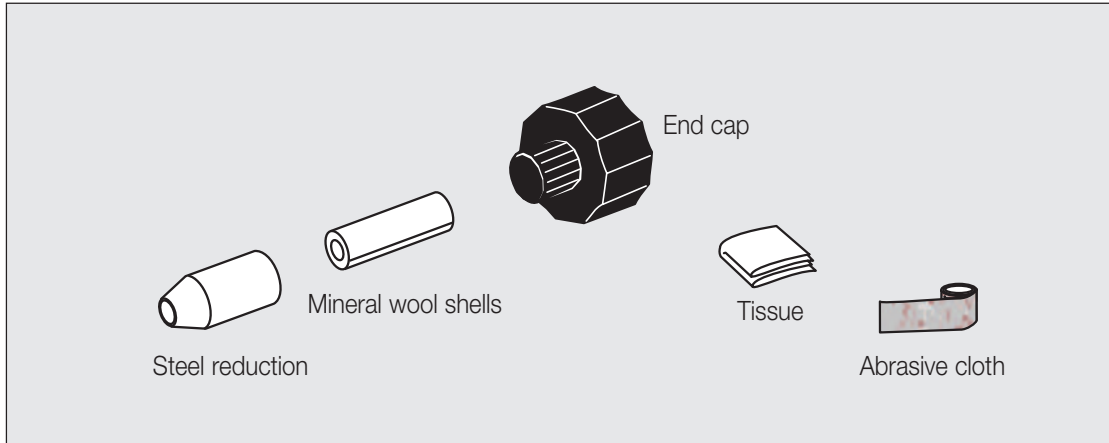


Important:

Never apply heat to creases, if any, since the material will be discoloured and the surface will crack.


Never apply heat underneath the end cap, as this may damage the end cap permanently.

Pockets of air under the end cap can be removed by bending a piece of welding wire into U-shape and pushing it underneath the end cap while it is still warm.


Use burner head dia. 51 mm for all dimensions.

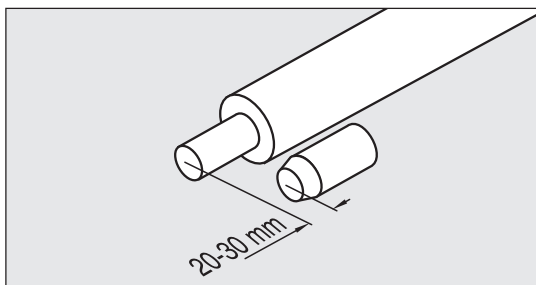


1. Place the steel reduction 20-30 mm from the steel pipe end.

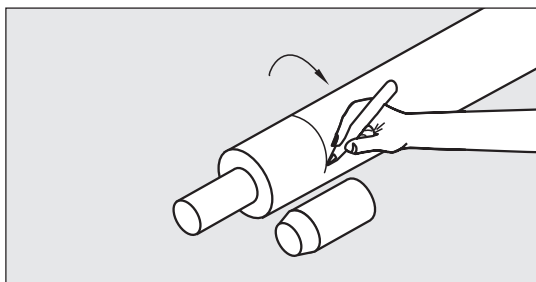


2. Mark the length of the steel reduction on the jacket.

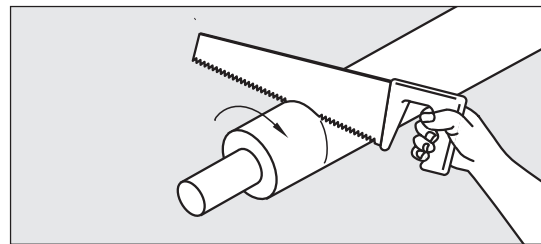

3. Cut the jacket and insulation using the marks as a guide.

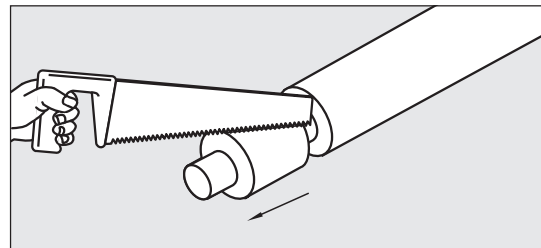

4. Cut lengthwise through the jacket and remove jacket and insulation material.

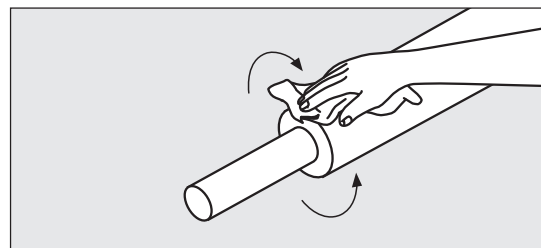


5. Clean all surfaces in the mounting area.

HDHEC


High temperature end cap

Fitting Instructions


2/3

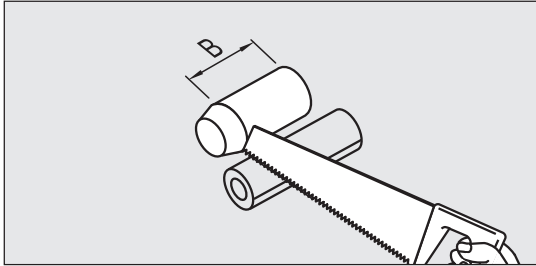


6. Adjust the mineral wool shells to the length (B) of the steel reduction.

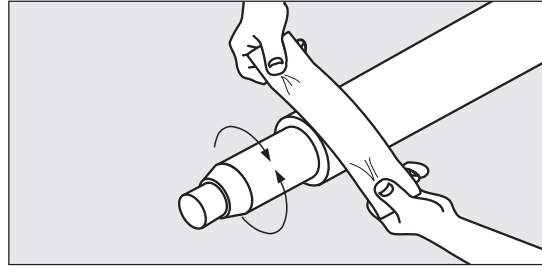


10. Activate the steel reduction and the jacket pipe with abrasive cloth grain size 80 at least 60 mm from the end of the jacket pipe.

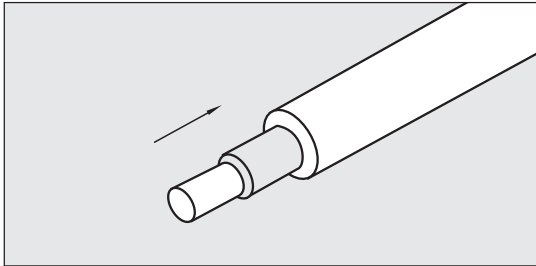


7. Place the mineral wool shells on the carrier pipe as close to the PUR insulation as possible.

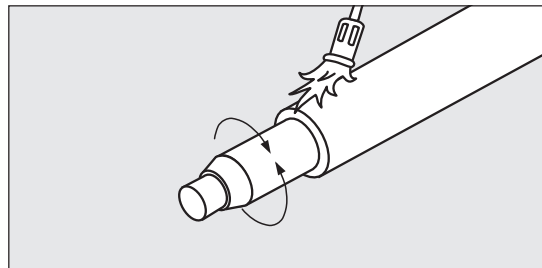


11. Activate the steel reduction and the jacket with gas burner at least 60 mm from the end of the jacket pipe until the jacket surface has a matt, silky look.

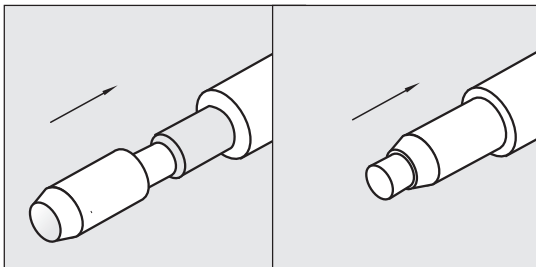

8. Pull the steel reduction onto the carrier pipe and the mineral wool shells. The steel reduction is placed correctly when it is in contact with the PUR insulation.

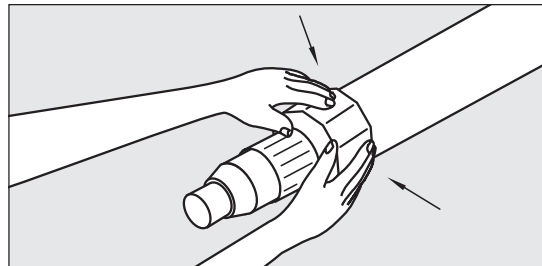

12. Remove the foil inside the end cap. Check that it is CLEAN and DRY, inside and out. Pull the end cap onto the steel reduction and jacket.

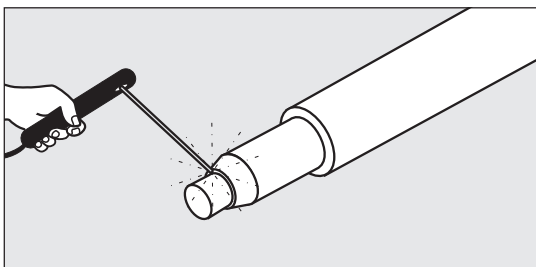


9. Weld the steel reduction to the carrier pipe. The welding has to be tightly.

HDHEC


High temperature end cap

Fitting Instructions


3/3

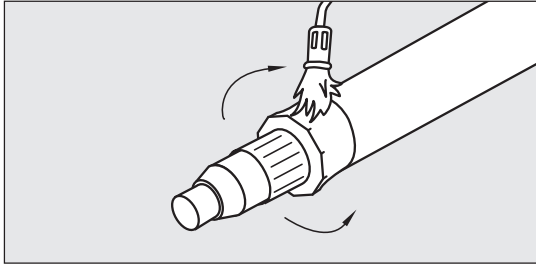

13. Start shrinking the end cap onto the jacket pipe only. DO NOT YET shrink the edge of the end cap nor the end surface onto the jacket pipe. The flame must be held at a right angle to the pipe surface.

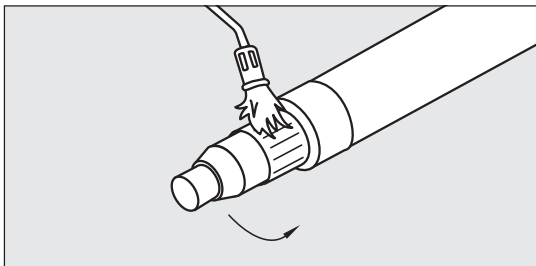

14. After a pause of approx. 3 min. shrink the end cap onto the steel reduction and at the same time the edge of the end cap and the end surface onto the edge of the end cap and the end surface onto the jacket pipe. The flame must be held at a right angle to the pipe surface.

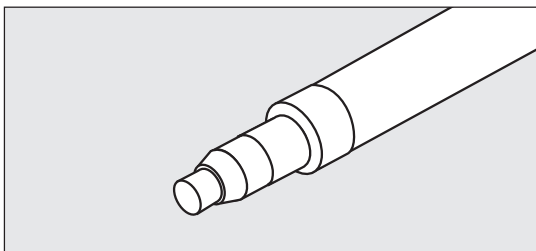

15. The end cap is complete when the sealing becomes visible on the steel reduction and the end cap is smooth.

Contact details

Denmark

LOGSTOR Denmark Holding ApS
Danmarksvej 11 | DK-9670 Løgstør

T: +45 99 66 10 00
E: logstor@kingspan.com



For the product offering in other markets please contact your local sales representative or visit www.logstor.com

Care has been taken to ensure that the contents of this publication are accurate, but Kingspan Limited and its subsidiary companies do not accept responsibility for errors or for information that is found to be misleading. Suggestions for, or description of, the end use or application of products or methods of working are for information only and Kingspan Limited and its subsidiaries accept no liability in respect thereof.

To ensure you are viewing the most recent and accurate product information, please scan the QR code directly above.

